

Impact of UV Exposure on FDM Materials



Introduction

Stratasys FDM® materials are used to create parts that are used in a variety of environmental conditions. To evaluate the impact of exposure to these conditions, FDM materials were exposed to UV light and humidity within a QUV environmental test chamber to imitate the damage from sun and rain. The change in material color and mechanical performance (tensile strength) was compared between control samples and those that experienced UV exposure. The results are included in this white paper.

Procedure

The materials tested for the impact of UV exposure are listed in Table 1, as well as which FDM printer and tip size was used to build the parts. For each material, 4 plaques were built in the flat (XY) orientation and 20 ASTM D638 coupons in the upright (ZX) orientation. For TPU, the tensile coupons were printed in the flat (XY) orientation. Individual coupons were preprocessed with Insight[™] software using default parameters and stabilizer walls as detailed in the <u>Material Testing Procedure</u>. The tensile coupons were built in 2 builds, each containing 10 coupons.

| Material | Printer | Тір |
|-----------------------------|---------|--------------------------------|
| ABS-CF10 | F370® | T14 (F123 Head) |
| Antero [®] 800NA | F900™ | T20F |
| Antero® 840CN03 | F900 | T20F |
| ASA (natural color) | F900 | T16 |
| Diran™ 410MF07 | F370 | T14 (F123 Head) |
| FDM [®] Nylon 12CF | F900 | T20C |
| PC (polycarbonate) | F900 | T16 |
| PC-ABS | F370 | T14 (F123 Head) |
| FDM® TPU 92A | F370 | T14 (F123 Elastomeric Head) |
| ULTEM™ 9085 resin | F900 | T16A |
| ULTEM™ 1010 resin | F900 | T14 |

Table 1. Printer and tips used to print each material for UV testing.

From the printed coupons in each material, one build of 10 D638 coupons and two plaques experienced UV exposure while the remaining two plaques and build of 10 D638 coupons were used as a control. A QUV chamber was used to provide consistent UV exposure. The samples were cycled in the QUV chamber per ASTM G154 - Standard Practice for Operation Fluorescent Light Apparatus for UV Lamp Apparatus Exposure of Nonmetallic Materials – for 1000 hours, alternating for eight hours at 60 °C (140 °F) and four hours at 50 °C (122 °F) with humidity and condensation.

To quantify the color changes of the materials, Commision Internationale de l'Eclairage (CIE) L*a*b* coordinates were utilized. The coordinates are modeled so that a color cannot be both red and green, or blue and yellow at the same time. The L* coordinates indicate how light/dark the color is, the a* is the red/green coordinate, and the b* is the blue/yellow coordinate. The delta of each coordinate (Δ L*, Δ a*, Δ b*) can be compared between two colors to indicate the change in hue or darkness. The total color difference (ΔE^*) is the root-square of all of the differences $(\Delta E_{ab}^* = \sqrt{(L_2^* - L_1^*)^2 - (a_2^* - a_1^*)^2 - (b_2^* - b_1^*)^2})$. (See https://sensing.konicaminolta.us/us/blog/ identifying-color-differences-using-l-a-b-or-l-<u>c-h-coordinates/</u> for further details on the CIE L*a*b* coordinates). Control plagues and those exposed to UV were both measured to see part color change.

Tensile coupons were conditioned for a minimum of 40 hours at 23 °C (73 °F) and 50% RH prior to testing. The coupons were tested per ASTM D638 – Standard Test Method for Tensile Properties of Plastics.

The Antero 840CN03, Nylon 12CF, and ABS-CF10 plaques were also tested for ESD properties per ASTM D257. Both surface and volume resistance were measured on the front and back of each plaque.

Results

Visual Results

To show the color change from UV exposure of each material, a picture of a plaque was taken as well as a microscope image. Figures 1 to 11 show the images of each material.

Table 2 contains the CIE L*A*b coordinate data that confirms the visual observations and quantifies the magnitude of change for each material. Nylon 12CF experienced the least amount of change in color from the UV exposure. ASA, Antero 800NA, and ULTEM[™] 1010 resin had minor color changes. PC, ABS-CF10, PC-ABS, TPU, Antero 840CN03, and ULTEM[™] 9085 resin have more notable color changes from the UV exposure.

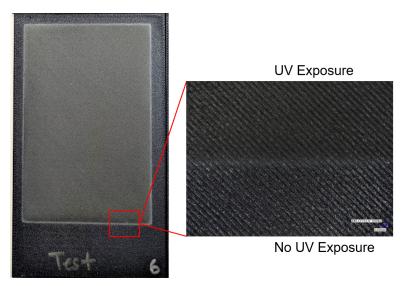


Figure 1. ABS-CF10 plaque with rectangular area that was exposed to UV. The exposed area experienced significant yellowing.

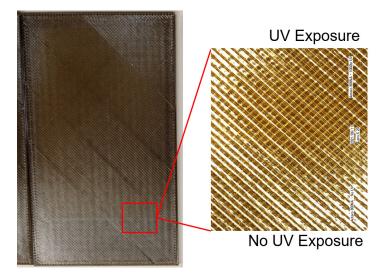


Figure 2. Antero 800NA plaque with rectangular area that was exposed to UV. Antero 800NA lightens and yellows slightly from the UV exposure.

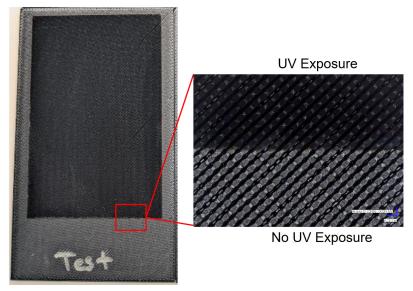


Figure 3. Antero 840CN03 plaque with rectangular area that was exposed to UV. The exposed area significantly darkened in color.

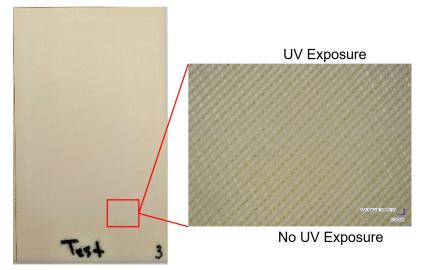


Figure 4. ASA plaque with rectangular area that was exposed to UV. Not much color change was observed on natural ASA.

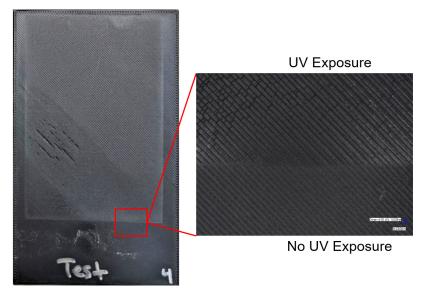


Figure 5. Diran 410MF07 plaque with rectangular area with UV exposure. Color difference and cracking was observed on the area exposed to UV.

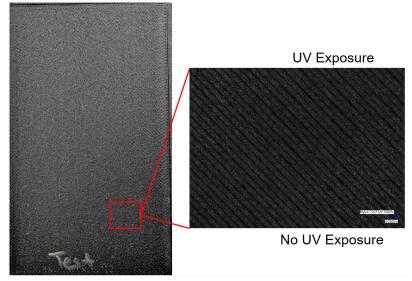


Figure 6. Nylon 12CF plaque with rectangular area that was exposed to UV. Nylon 12CF exhibited the least visual change of all the materials tested.

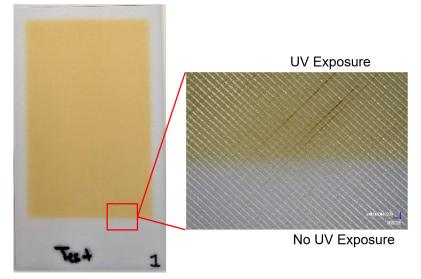


Figure 7. PC plaque with rectangular area that was exposed to UV. The exposed area exhibited darkening and a more yellow appearance.

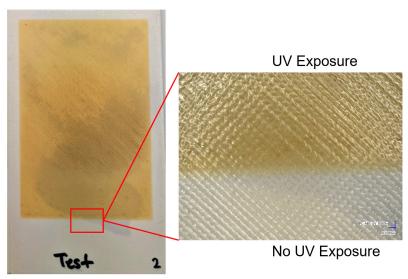


Figure 8. PC-ABS plaque with rectangular area that was exposed to UV. The exposed area exhibited darkening and yellowing.

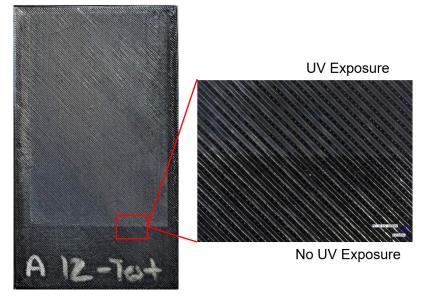


Figure 9. TPU plaque with rectangular area that was exposed to UV. The exposed area darkened, as well as increasing the red and blue CID $L^*a^*b^*$ coordinates.

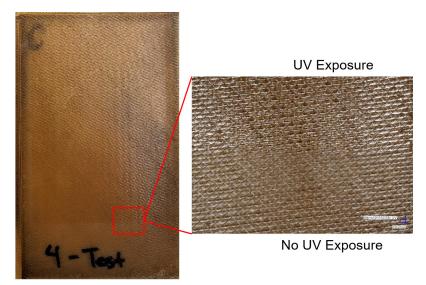


Figure 10. ULTEMTM 1010 resin plaque with rectangular area that was exposed to UV. The exposed area showed a higher gloss than the non-exposed area.

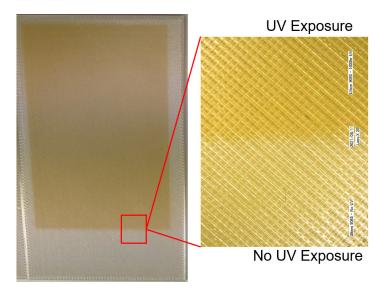


Figure 11. ULTEM[™] 9085 resin plaque with rectangular area that was exposed to UV. The ULTEM[™] 9085 resin material appears to have darkened and yellowed from the UV exposure.

| | | Plaque 1 | | | | Plaque 2 | | | |
|----------------------|----------------|----------|---------|----------|-------|----------|---------|----------|-------|
| Material | Conditioning | | a* | b* | ΔE | L | a* | b* | ΔΕ |
| ABS CF10 | No UV Exposure | 38.14 | -0.46 | -3.18 | | 38.13 | -0.56 | -3.13 | |
| | UV Exposure | 41.04 | -0.84 | 1.22 | | 36.11 | -0.6 | 2.26 | |
| | Delta | 2.9 | -0.39 | 4.41 | 5.29 | -2.02 | -0.04 | 5.39 | 5.75 |
| | Color Change | Lighter | Greener | Yellower | | Darker | Greener | Yellower | |
| | No UV Exposure | 41.32 | 2.73 | 7.55 | | 41.51 | 2.72 | 7.59 | |
| Antero | UV Exposure | 42.78 | 3.52 | 12.79 | | 43.56 | 3.5 | 12.81 | |
| 800NA | Delta | 1.46 | 0.78 | 5.24 | 5.49 | 2.06 | 0.79 | 5.22 | 5.66 |
| | Color Change | Lighter | Redder | Yellower | | Lighter | Redder | Yellower | |
| | No UV Exposure | 23.48 | 0.38 | -1.55 | | 26.13 | 0.35 | -1.45 | |
| Antero | UV Exposure | 10.97 | 0.21 | -2.07 | | 13.31 | 0.42 | -2.37 | |
| 840CN03 | Delta | -12.51 | -0.17 | -0.51 | 12.52 | -12.82 | 0.07 | -0.93 | 12.85 |
| | Color Change | Darker | Greener | Bluer | | Darker | Redder | Bluer | |
| | No UV Exposure | 81.56 | 0.41 | 13.84 | | 90.57 | -0.4 | 14.27 | |
| 101 | UV Exposure | 90.66 | -0.9 | 14.67 | | 90.74 | -1.09 | 14.76 | |
| ASA | Delta | 9.1 | -1.31 | 0.84 | 9.23 | 0.17 | -0.69 | 0.49 | 0.86 |
| | Color Change | Lighter | Greener | Yellower | | Lighter | Greener | Yellower | |
| | No UV Exposure | 36.19 | 0.32 | -0.76 | | 36.96 | 0.23 | -0.87 | |
| Diran | UV Exposure | 37.73 | 0.55 | -0.6 | | 37.06 | 0.41 | -0.67 | |
| 410MF07 | Delta | 1.54 | 0.23 | 0.15 | 1.57 | 0.1 | 0.17 | 0.2 | 0.28 |
| | Color Change | Lighter | Redder | Yellower | | Lighter | Redder | Yellower | |
| | No UV Exposure | 31.63 | 0.27 | 0.09 | | 31.96 | 0.13 | -0.1 | |
| Nylon | UV Exposure | 32.07 | 0.29 | 0.75 | | 31.4 | 0.22 | 0.33 | |
| 12CF | Delta | 0.44 | 0.01 | 0.66 | 0.79 | -0.55 | 0.09 | 0.43 | 0.71 |
| | Color Change | Lighter | Redder | Yellower | | Darker | Redder | Yellower | |
| | No UV Exposure | 88.89 | -1.17 | -1.02 | | 89.11 | -1.16 | -1.13 | |
| PC | UV Exposure | 81.26 | 0.16 | 31.55 | | 81.22 | 0.04 | 30.58 | |
| 10 | Delta | -7.63 | 1.33 | 32.57 | 33.48 | -7.89 | 1.2 | 31.71 | 32.7 |
| | Color Change | Darker | Redder | Yellower | | Darker | Redder | Yellower | |
| | No UV Exposure | 98.2 | 0.85 | 10.44 | | 98.24 | 0.85 | 10.26 | |
| PC-ABS | UV Exposure | 89.37 | 4.95 | 39.79 | | 81.28 | 5.14 | 35.1 | |
| | Delta | -8.83 | 4.1 | 29.35 | 30.93 | -16.96 | 4.29 | 24.84 | 30.38 |
| | Color Change | Darker | Redder | Yellower | | Darker | Redder | Yellower | |
| | No UV Exposure | 25.71 | -0.49 | -0.86 | | 24.72 | -0.5 | -0.96 | |
| TPU 92A | UV Exposure | 24.37 | -0.35 | -1.38 | | 23.15 | 0.08 | -1.1 | |
| | Delta | -1.34 | 0.14 | -0.52 | 1.44 | -1.57 | 0.58 | -0.13 | 1.68 |
| | Color Change | Darker | Redder | Bluer | | Darker | Redder | Bluer | |
| | No UV Exposure | 46.69 | 3.19 | 12.93 | | 52.08 | 3.65 | 15.67 | |
| ULTEM™ 1010 resin | UV Exposure | 47.9 | 5.17 | 15.97 | | 45.95 | 6.12 | 16.02 | |
| | Delta | 1.22 | 1.98 | 3.05 | 3.83 | -6.13 | 2.47 | 0.35 | 6.62 |
| | Color Change | Lighter | Redder | Yellower | | Darker | Redder | Yellower | |
| ULTEM™ 9085 resin | No UV Exposure | 78.78 | -2.66 | 12.22 | | 78.93 | -2.61 | 11.55 | |
| | UV Exposure | 74.05 | -0.65 | 26.54 | | 73.97 | -0.55 | 26.49 | |
| | Delta | -4.73 | 2.01 | 14.32 | 15.21 | -4.96 | 2.06 | 14.94 | 15.87 |
| | Color Change | Darker | Redder | Yellower | | Darker | Redder | Yellower | |

Table 2. Color differences of each material with and without UV exposure.

Mechanical Results

Table 3 and Table 4 contain the mechanical data summaries for each material with and without UV exposure in English and metric units respectively. Figures 12 and 13 show the effect of the UV exposure on the stress at break for the upright (ZX) coupons. Figure 14 shows the impact of UV exposure of the ultimate tensile strength of the flat (XY) TPU coupons.

The impact of UV exposure on mechanical performance varies based on the material. Nylon 12CF and ULTEM[™] 1010 resin parts show increased strength after UV exposure. The tensile strength of ULTEM[™] 9085 resin coupons remained about the same. The tensile strength of PC and TPU decreases by more than 10%. The remaining materials had minor changes to the mechanical performance. See Table 5 for a summary of change in tensile strength following UV exposure.

| Material | Conditioning | Yield Strength (psi) | Stress at Break (psi) | Elongation at break (%) | Modulus (ksi) |
|----------------------|----------------|-------------------------|--------------------------|-------------------------|---------------|
| | No UV Exposure | 3150 | 3140 | 1.5 | 284 |
| ABS CF10 | UV Exposure | 3010 | 2990 | 1.3 | 295 |
| | No UV Exposure | 8320 | 8360 | 2.4 | 392 |
| Antero 800NA | UV Exposure | 8310 | 8670 | 2.4 | 399 |
| | No UV Exposure | 8270 | 8400 | 2.4 | 396 |
| Antero 840CN03 | UV Exposure | 8050 | 8040 | 2.2 | 401 |
| ACA | No UV Exposure | 4430 | 4420 | 2.8 | 264 |
| ASA | UV Exposure | 4390 | 4290 | 2.3 | 283 |
| | No UV Exposure | 3760 | 3780 | 2.5 | 195 |
| Diran 410MF07 | UV Exposure | 3830 | 3840 | 2.3 | 227 |
| N.L. 1005 | No UV Exposure | 4760 | 4720 | 1.7 | 361 |
| Nylon 12CF | UV Exposure | 6500 | 6460 | 2.2 | 421 |
| | No UV Exposure | 6370 | 5940 | 3.0 | 258 |
| PC | UV Exposure | 4230 | 4200 | 1.6 | 289 |
| | No UV Exposure | 3880 | 3870 | 2.4 | 224 |
| PC-ABS | UV Exposure | 3710 | 3720 | 2.1 | 230. |
| | No UV Exposure | 2730 | 2740* | 520* | 3.23 |
| TPU 92A* | UV Exposure | 2330 | 2330* | 480* | 3.16 |
| | No UV Exposure | 8130 | 8080 | 3.5 | 293 |
| ULTEM™ 9085 resin | UV Exposure | 8060 | 8070 | 3.7 | 302 |
| ULTEM™ 1010 resin | No UV Exposure | 8280 | 8570 | 2.6 | 375 |
| ULIENI'''' TUTUTESIN | UV Exposure | 9630 | 9530 | 2.9 | 378 |

Table 3. Average tensile performance of each material with and without UV exposure (English units).

Note:

*For TPU, the flat coupons were used. The coupons did not break so the elongation at end of test and UTS were reported for elongation at break and break strength, respectively.

| Material | Conditioning | Yield Strength (MPa) | Stress at Break (MPa) | Elongation at break (%) | Modulus (GPa) |
|---------------------------------|----------------|-------------------------|--------------------------|-------------------------|------------------|
| | No UV Exposure | 21.7 | 21.7 | 1.5 | 1.96 |
| ABS CF10 | UV Exposure | 20.8 | 20.6 | 1.3 | 2.03 |
| | No UV Exposure | 57.4 | 57.6 | 2.4 | 2.70 |
| Antero 800NA | UV Exposure | 57.3 | 59.7 | 2.4 | 2.75 |
| Antero 840CN03 | No UV Exposure | 57.0 | 57.9 | 2.4 | 2.73 |
| Antero 8400N03 | UV Exposure | 55.5 | 55.4 | 2.2 | 2.76 |
| A.C.A. | No UV Exposure | 30.5 | 30.5 | 2.8 | 1.82 |
| ASA | UV Exposure | 30.3 | 29.5 | 2.3 | 1.95 |
| | No UV Exposure | 26.0 | 26.0 | 2.5 | 1.34 |
| Diran 410MF07 | UV Exposure | 26.4 | 26.5 | 2.3 | 1.56 |
| | No UV Exposure | 32.8 | 32.5 | 1.7 | 2.49 |
| Nylon 12CF | UV Exposure | 44.8 | 44.5 | 2.2 | 2.90 |
| PC | No UV Exposure | 43.9 | 40.9 | 3.0 | 1.78 |
| | UV Exposure | 29.2 | 29.0 | 1.6 | 1.99 |
| PC-ABS | No UV Exposure | 26.7 | 26.7 | 2.4 | 1.54 |
| PC-ABS | UV Exposure | 25.6 | 25.7 | 2.1 | 1.59 |
| | No UV Exposure | 18.8 | 18.9* | 520* | 0.0223 |
| TPU 92A* | UV Exposure | 16.0 | 16.0* | 480* | 0.0217 |
| ULTEM™ 9085 resin | No UV Exposure | 56.0 | 55.7 | 3.5 | 2.02 |
| | UV Exposure | 55.5 | 55.6 | 3.7 | 2.08 |
| ULTEM™ 1010 resin | No UV Exposure | 57.1 | 59.1 | 2.6 | 2.59 |
| OLI ENI ^M TOTO RESIN | UV Exposure | 66.4 | 65.7 | 2.9 | 2.61 |

Table 4. Average tensile performance of each material with and without UV exposure (metric units).

Note:

*For TPU, the flat coupons were used. The coupons did not break so the elongation at end of test and UTS were reported for elongation at break and break strength, respectively.

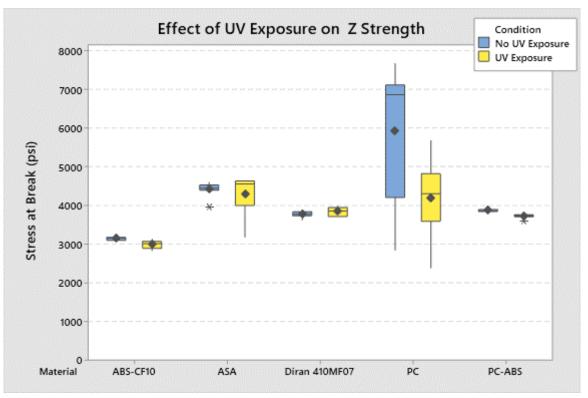


Figure 12. Effect of UV exposure on Z strength of tensile coupons.

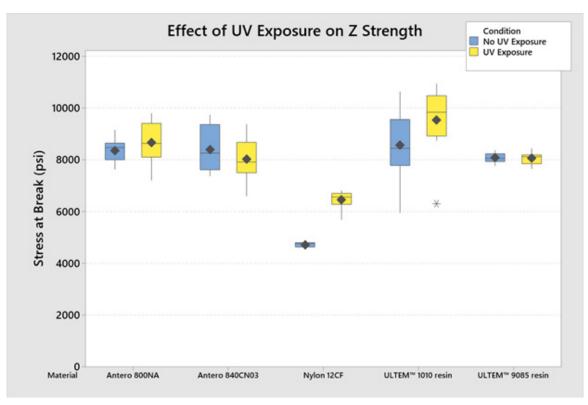


Figure 13. Effect of UV exposure on tensile Z strength for high performance materials.

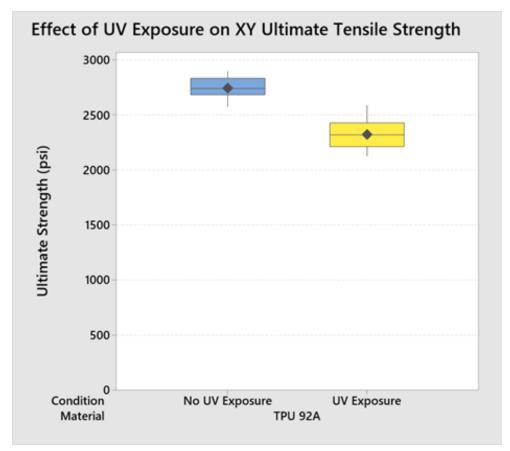


Figure 14. Effect of UV exposure on XY UTS of TPU.

| Material | Stress at Break |
|-------------------|-----------------|
| ABS-CF10 | -4.9% |
| Antero 800NA | 3.6% |
| Antero 840CN03 | -4.3% |
| ASA | -3.0% |
| Diran 410MF07 | 1.8% |
| Nylon 12CF | 36.8% |
| PC | -29.2% |
| PC-ABS | -3.8% |
| TPU 92A | -15.3% |
| ULTEM™ 9085 resin | -0.1% |
| ULTEM™ 1010 resin | 11.2% |

Table 5. Percent increase of stress at break after UV exposure.

ESD Resistivity

The ESD resistivity was measured for Antero 840CN03, ABS-CF10, and Nylon 12CF with the measurements as shown in Table 6. Antero 840CN03 and Nylon 12CF show a slight decrease in the resistance on the face that was exposed to the UV, despite Nylon 12CF not having apparent degradation of the surface as indicated by a color change.

| Material | Conditioning | ESD Properties: Surface & Volume Resistance | | | | | | |
|-------------------|----------------|---|--------------------|---------|-----------------|--------------------|---------|-----------|
| | | Plaque | Surface (Ω/square) | | | Volume (Ω-cm) | | |
| | | Plaque | Front ¹ | Back | Ave. Δ^2 | Front ¹ | Back | Ave. Δ² |
| | No UV Exposure | 1 | 1.1E+13 | 1.6E+12 | | 2.1E+13 | 5.7E+13 | |
| ABS CF10 | | 2 | 9.7E+12 | 1.1E+13 | | 3.5E+13 | 4.3E+13 | |
| ABS CFTU | UV Exposure | 1 | 3.8E+13 | 2.4E+13 | 3.64E+13 | 5.1E+13 | 5.5E+13 | 1.78E+13 |
| | | 2 | 5.6E+13 | 6.1E+13 | | 6.2E+13 | 5.9E+13 | |
| Antero 840CN03 | No UV Exposure | 1 | 3.1E+05 | 3.8E+05 | | 4.2E+05 | 4.9E+05 | |
| | | 2 | 1.6E+05 | 4.1E+05 | | 3.1E+05 | 3.3E+05 | |
| | UV Exposure | 1 | 1.8E+04 | 1.2E+05 | -2.23E+05 | 4.6E+04 | 2.1E+05 | -2.53E+05 |
| | | 2 | 1.2E+04 | 2.2E+05 | | 3.2E+04 | 2.5E+05 | |
| Nylon 12CF | No UV Exposure | 1 | 1.3E+05 | 1.3E+05 | | 8.4E+04 | 4.9E+04 | |
| | | 2 | 9.9E+04 | 1.7E+05 | | 6.7E+04 | 1.6E+05 | |
| | UV Exposure | 1 | 2.3E+04 | 3.2E+04 | -1.04E+05 | 2.4E+04 | 2.2E+04 | -6.83E+04 |
| | | 2 | 2.3E+04 | 3.7E+04 | | 2.7E+04 | 1.4E+04 | -0.03E+04 |

Table 6. ESD properties resistivity data.

Note:

- 1. Front (exposed) for coupons with UV exposure.
- 2. Average Δ is the difference between the average non-exposed faces from the faces exposed to UV. A negative ave. Δ indicates a decrease in the average of the volume or surface resistance.

Conclusion

13

Following 1000 hours of UV and humidity exposure, there is now greater understanding of material performance that can aid in material selection for applications. Not all materials performed similarly. Some experienced few changes while others experienced declines in strength. PC and TPU had the least favorable impacts of UV exposure with changes in color, as well as tensile strength decreases of greater than 15%. ULTEM™ 9085 resin yellowed and darkened in color, but tensile strength was not impacted.

The UV exposure had the most favorable impacts on Nylon 12CF, ULTEM™ 1010 resin, and Antero 800NA. Antero 800NA had minimal color changes and increased tensile strength by 3.6%. ULTEM™ 1010 resin increased tensile strength by 11.2% and had minimal color change to the material. Nylon 12CF faired the best with UV exposure with a 36.8% increase in tensile strength, slight increase in conductivity, and the least amount of color change of all materials. The suggested hypothesis for the increase in the strength is the impact of extended conditioning due to exposure to temperature and moisture. Moisture would typically decrease the strength of nylon, but the increased elongation at break suggests that the material underwent toughening.

USA - Headquarters

7665 Commerce Way Eden Prairie, MN 55344, USA +1 952 937 3000

ISRAEL - Headquarters

1 Holtzman St., Science Park PO Box 2496 Rehovot 76124, Israel +972 74 745 4000

stratasys.com

White Pape

ISO 9001:2015 Certified

FMFΔ

Airport Boulevard B 120 77836 Rheinmünster, Germany +49 7229 7772 0

ASIA PACIFIC 7th Floor, C-BONS International Center 108 Wai Yip Street Kwun Tong Kowloon Hong Kong, China + 852 3944 8888



GET IN TOUCH. www.stratasys.com/contact-us/locations

© 2022 Stratasys. All rights reserved. Stratasys, the Stratasys Signet logo, FDM, Fortus and F370 are registered trademarks of Stratasys Inc. Antero 800NA, Antero 840CN04, Diran 410MF07, FDM Nylon 12CF, FDM TPU 92A, Fortus 450mc and Insight are trademarks of Stratasys, Inc. 9085, 1010 and ULTEMTM are trademarks of SABIC, its affiliates or subsidiaries. All other trademarks are the property of their respective owners, and Stratasys assumes no responsibility with regard to the selection, performance, or use of these non-Stratasys products. Product specifications subject to change without notice. WP_FDM_UV Aging_A4_0123a